

## Description of a pin-pulling process with aid of dimensional analysis

***Citation for published version (APA):***

Muller, H. L., Kregting, W. T., Smit, J., & Veenstra, P. C. (1967). *Description of a pin-pulling process with aid of dimensional analysis*. (TH Eindhoven. Afd. Werktuigbouwkunde, Laboratorium voor mechanische technologie en werkplaatstechniek : WT rapporten; Vol. WT0174). Technische Hogeschool Eindhoven.

***Document status and date:***

Published: 01/01/1967

***Document Version:***

Publisher's PDF, also known as Version of Record (includes final page, issue and volume numbers)

***Please check the document version of this publication:***

- A submitted manuscript is the version of the article upon submission and before peer-review. There can be important differences between the submitted version and the official published version of record. People interested in the research are advised to contact the author for the final version of the publication, or visit the DOI to the publisher's website.
- The final author version and the galley proof are versions of the publication after peer review.
- The final published version features the final layout of the paper including the volume, issue and page numbers.

[Link to publication](#)

***General rights***

Copyright and moral rights for the publications made accessible in the public portal are retained by the authors and/or other copyright owners and it is a condition of accessing publications that users recognise and abide by the legal requirements associated with these rights.

- Users may download and print one copy of any publication from the public portal for the purpose of private study or research.
- You may not further distribute the material or use it for any profit-making activity or commercial gain
- You may freely distribute the URL identifying the publication in the public portal.

If the publication is distributed under the terms of Article 25fa of the Dutch Copyright Act, indicated by the "Taverne" license above, please follow below link for the End User Agreement:

[www.tue.nl/taverne](http://www.tue.nl/taverne)

***Take down policy***

If you believe that this document breaches copyright please contact us at:

[openaccess@tue.nl](mailto:openaccess@tue.nl)

providing details and we will investigate your claim.



technische hogeschool eindhoven

laboratorium voor mechanische technologie en werkplaatstechniek

rapport van de sectie: **Werkplaatstechniek**

titel: **Description of a Pin-Pulling process with aid of dimensional analysis.**

auteur(s):  
**Prof.dr.ir. H.L. Muller**  
**Ir. W.Th. Kregting**  
**Dr. J. Smit**

sectieleider:

hoogleraar: **Prof.dr.ir. H.L. Muller**

samenvatting

Summary

The total process of pin-pulling consists of two main processes.

1. The thermal behaviour of an electrically heated piece of wire clamped on both ends.
2. The construction occurring when the wire is overstretched, and many interrelated effects such as change in dimension because of plastic flow, change in heat intensity resulting in different temperature-time relations at different places. Direct mathematical analysis is very difficult; therefore an empirical approach is used, whereby the test results are processed for practical application by means of dimensional analysis. The following process-description shows a way to determine the required current, warming-up time and tensile force for different materials.

Though the experiments have been performed in the sphere of the factory practice and thus could not get that kind of attention that is usual for laboratory tests, the question if it is possible to describe this process with aid of dimensional analysis seems answered to us quite well in the affirmative.

prognose

Presented to the C.I.R.P. conference 1967 by  
Prof.dr.P.G. Veenstra.

blz. 1 van 17 blz.

rapport nr. 0174

codering:

P.6.c.1

UDC:62-13;

621.385.032

trefwoord:

**Pin-Pulling  
Process**

datum:

mei 1967

aantal blz.

17

geschikt voor  
publicatie in:

"Annals of  
the C.I.R.P."

DESCRIPTION OF A PIN-PULLING PROCESS  
WITH AID OF DIMENSIONAL ANALYSIS

by

PROF. DR. IR. H. L. MULLER

IR. W. TH. KREGTING

DR. J. SMIT

TECHNOLOGICAL UNIVERSITY EINDHOVEN  
HOLLAND

Presented to the C.I.R.P. conference 1967

by P.C. Veenstra

## Materialien.

Obgleich die Versuche unter Betriebsverhältnissen durchgeführt wurden, und daher keine labormässige Aufmerksamkeit in Anspruch nehmen konnten, haben die Aussichten auf eine dimensionsanalytische Beschreibung dieses Prozesses sich unseres Erachtens verhältnismässig gut bestätigt.

## Sommaire

Le procédé de "pin-pulling" se compose de deux processus principaux:

1. la conduite thermique d'une piece de fil chauffée electriquement et fixée par serrage à deux côtés.
2. la contraction se présentant en cas que le fil sera surtendu et beaucoup d'effets se tenant se produisent, comme modification de dimension en conséquence de fluidité plastique, modification d'intensité de chaleur, concentrant en temperature-temps relations différentes à places différentes.

L'application de l'analyse mathématique directe est difficile; pour cette raison une méthode empirique est choisie pour les résultats d'essai applicables pratiquement, et bien l'analyse dimensionnelle.

Le procédé concernant fait voir une voie de fixer le courant requis, le temps de chauffage et la force de tension pour des matériaux différents.

Bien que les expériences sont faites au milieu de l'organisation d'atelier, impliquant que cela n'appelle pas l'attention désirée pour les résultats, la question de la possibilité de résoudre ce procédé à l'aide de l'analyse dimensionnelle doit être répondu affirmativement.

### Summary

The total process of pin-pulling consists of two main processes

1. The thermal behaviour of an electrically heated piece of wire clamped on both ends.
2. The construction occurring when the wire is overstretched, and many interrelated effects such as change in dimension because of plastic flow, change in heat intensity resulting in different temperature-time relations at different places.

Direct mathematical analysis is very difficult; therefore an empirical approach is used, whereby the test results are processed for practical application by means of dimensional analysis. The following process-description shows a way to determine the required current, warming-up time and tensile force for different materials.

Though the experiments have been performed in the sphere of the factory practica and thus could not get that kind of attention that is usual for laboratory tests, the question if it is possible to describe this process with aid of dimensional analysis seems answered to us quite well in the affirmative.

### Zusammenfassung

Der gesamte Stift-Ziehproceß setzt sich zusammen aus zwei wichtigen Teilvorgängen,

1. dem thermodynamischen Verhalten eines elektrisch geheizten Drahtstückes, dass mit beiden Seiten eingeklemmt ist.
2. der eintretenden Einschnürung bei stossartiger Überbelastung des Drahtes und mehreren damit zusammenhängenden Effekten, wie z.B. plastische Massänderung und örtliche Unterschiede in der Heizwirkung, woraus sich von Ort zu Ort ungleiche Temperatur-Zeitbeziehungen ergeben.

Eine unmittelbare mathematische Analyse ist mit grossen Schwierigkeiten verbunden; daher wurde versuchsmässig an die Aufgabe herangetreten. Die Versuchsergebnisse wurden mittels Dimensionsanalyse für praktische Verwendung zugänglich gemacht. Die Prozessbeschreibung zeigt eine Möglichkeit zur Bestimmung des erforderlichen Stromes, der Erwärmungsdauer und der benötigten Zugbelastung für verschiedene

### Introduction

In the electronic component industry pins are widely used as parts for radio tubes and transistors. The pins vary in diameter from 0.2 to 2.0 mm and in length from 8 to 72 mm. If they are to be handled by vibratory hoppers and inserting equipment, the pins must meet the following requirements:

- The pin must have pointed ends and a sufficiently smooth point surface.
- Length variation of the pin must be limited (normal tolerance  $\pm 0.2$  mm).

Drawing of a pin is shown in fig. 1.

These pins can be manufactured by various methods such as cutting, rolling and pulling. Of these three methods the last will be dealt with more in detail. The machine used for pulling apart the wire, works on the following principle: A length of wire is clamped between two chucks that can be moved in relation to each other. A current is passed via the chucks through the wire as a result of which its temperature will increase. The heated wire is stretched and separated by moving the chucks apart.

Two different processes are involved, viz.

- a. The thermal behaviour of an electrically heated piece of wire clamped on both ends.
- b. The constriction occurring when the wire is over-stretched.

The two processes are interrelated by a number of effects such as change in dimension because of plastic flow, change in heat intensity resulting in different temperature-time relations at different places.

For different products the material and pin dimensions are given within certain limits.

The practical problem was to find

1. the optimal conditions for the process
2. a practical way to bring the machine setting as close as possible to these conditions.

First the stretching process will be studied; the results will then be worked out to dimensionless numbers. With help of these numbers the setting of the machine in practical cases can be done more systematically.

### The method chosen to solve the problem

As was already outlined above, the total process consists of many interrelated effects. Direct mathematical analysis is very difficult; therefore an empirical approach is used, whereby the test results are processed for practical application by means of dimensional analysis.

Readers are referred concerning this method to lit. 1, 2. The use of dimensional analysis for a practical problem depends on the hypothesis that its solution can be expressed in terms of certain variables by means of a homogeneous (dimensional) equation. This hypothesis is based on the trivial fact that physical equations are homogeneous in dimension and that relations can be deduced from these equations and must therefore be homogeneous in dimension too.

However, if an equation is homogeneous in dimension, it can be reduced to a relation between a complete set of dimensionless products (Buckingham theorem). It is obviously necessary that an adequate physical model is used in which all important relevant factors are taken into consideration.

### The physical model

Constriction of the wire begins once the stress has exceeded a certain critical value. This stress is temperature dependent and, generally speaking, it may be said that the required critical stress decreases with increasing temperature. As the temperature reaches a maximum in the plane of symmetry, the critical value will be exceeded first in this plane. The physical quantities determining the temperature at a certain place are:

- |                          |                             |
|--------------------------|-----------------------------|
| a. the power supplied P  |                             |
| b. the dissipated heat Q | all related to the material |
| c. the heat capacity C   | element under consideration |

If we now consider the total length of wire between clamping points and simplify the situation by using average values of temperature etc., then the power supplied

$$(P_{\text{tot}} = I^2 R = \frac{I^2 \rho \cdot l}{\pi/4 d^2}) \text{ will depend on}$$

- |               |                                      |
|---------------|--------------------------------------|
| 1. $\rho I^2$ | with $\rho$ = electrical resistivity |
| 2. l          | I = current                          |
| 3. d          | l = distance between the chucks      |
|               | d = wire diameter                    |

For the purpose of finding dimensional quantities this simplification may be justified. The wire temperature is considered to be only variable with  $x$  and the time  $t$ .

The dissipated heat for an element in the middle of the wire ( $Q = \lambda \cdot A \cdot \frac{dT}{dx} \cdot t$ ) will depend on

1.  $\lambda$  with  $\lambda$  = heat conductivity
2.  $T$   $T$  = temperature of the middle of the wire
3.  $t$   $t$  = warming-up time
4.  $l$   $l$  = distance between the chucks
5.  $d$   $d$  = wire diameter

The constriction is determined by

1. the deformation energy / unit volume  $E$
2. the tensile strength at  $T^\circ\text{C}$   $\sigma_T$

$$E = \frac{F}{A} \cdot \varepsilon$$

The deformation energy depends on:

1.  $F$  with  $F$  = applied force
2.  $A$   $A$  = surface of a plane, perpendicular
3.  $\varepsilon$  on the wire
- $\varepsilon$  = strain

In considering these simplified equations, we supposed to have the following variables to be of importance for our dimensional analysis.

1.  $I^2$  in Watt.m  $M \cdot L^{-3} \cdot T^{-3}$

It is permissible to combine  $I$  with  $\rho$ , because they are the only variables containing the electrical basic units of charge for current.

2.  $E$  = deformation energy / unit volume in  $\text{Nm/m}^3$   $M \cdot L^{-1} \cdot T^{-2}$

3.  $C$  = heat capacity / unit volume in  $\text{Nm/m}^3 \cdot ^\circ\text{C}$   $M \cdot L^{-1} \cdot T^{-2} \cdot \theta^{-1}$

4.  $\lambda$  = heat conductivity in  $\text{Nm/msec} \cdot ^\circ\text{C}$   $M \cdot L \cdot T^{-3} \cdot \theta^{-1}$

5.  $d$  = wire diameter in m  $L$

6.  $l$  = distance between the chucks in m  $L$

7.  $T$  = temperature of the middle of the wire  $\theta$

8.  $t$  = warming-up time in sec.  $T$

9.  $\sigma_T$  = tensile strength of the wire at  $T^\circ\text{C}$   $M \cdot L^{-1} \cdot T^{-2}$



Table 1. Dimensional matrix of the variables

	E	$\rho I^2$	t	T	d	C	$\lambda$	1	$\sigma_T$
mass	1	1	0	0	0	1	1	0	1
length	-1	3	0	0	1	-1	1	1	-1
time	-2	-3	1	0	0	-2	-3	0	-2
temperature	0	0	0	1	0	-1	-1	0	0

From these variables the following complete set of dimensionless products can be formed.

$$V_1 = \frac{\lambda \cdot t}{C l^2}$$

$$V_2 = \frac{\lambda \cdot T l^2}{\rho I^2}$$

$$V_3 = \frac{1}{d}$$

$$V_4 = \frac{F}{A \sigma_T}$$

$$V_5 = \frac{\rho I^2 t}{F l^2}$$

The following physical significance can now be given to the dimensionless numbers.

$V_1$  = dissipated heat / heat capacity

$V_2$  = dissipated heat / generated heat

$V_3$  = geometrical proportion

$V_4$  = force applied / force required

$V_5$  = energy supplied / mechanical energy

In order to determine the relations between these numbers, it will be necessary to measure some variables by tests on the production machines.

From the literature (see lit. 3 and lit. 4) we derive the following as a function of temperature.

1. the specific electrical resistivity
2. the specific heat
3. the heat conductivity
4. the tensile strength at temperature T

The other variables are measured at the machine. The following five materials are at our disposal.

1. Nickel
2. Nickel-Iron 50/50
3. Nickel plated Iron
4. Copper + 2 % Ag
5. Molybdenum

All with a diameter of 1 mm.

Tabel 2. Results of measurement

	Nickel	Nickel-Iron 50/50	Nickel-Plated Fe	Copper + 2 % Ag	Molybdenum
I av. Amp.	396	240	297	1131	707
F N	80	70	70	75	110
T °C	572	607	465	310	705
t sec.	0.08	0.08	0.08	0.04	0.04
C. 10 <sup>6</sup> Nm/ m <sup>3</sup> °C	4.63	4.58	5.02	3.74	2.78
λ Nm/ msec°C	50.2	21.4	42	369	113
ρ. 10 <sup>8</sup> m	36.5	11.5	53	88	23.3
σ <sub>T</sub> . 10 <sup>6</sup> N/m <sup>2</sup>	250	350	250	88	240
1. 10 <sup>3</sup> m	2	1.94	1.94	2.0	2.24

Dimensionless numbers that are useful in practice

The dimensionless numbers  $V_1$  to  $V_5$  incl. are calculated for the five materials mentioned above and are shown in the table below.

Table 3. Values of the dimensionless numbers

	$V_1$	$V_2$	$V_3$	$V_4$	$V_5$
Ni	0.218	2.00	0.463	0.40	14.3
NiFe	0.1	0.732	0.515	0.246	19
Fe	0.178	1.58	0.515	0.356	14.1
Cu	0.986	12.2	0.5	1.08	5.0
Mo	0.325	3.42	0.446	0.53	8.4

Represented on log-log paper the relations between  $V_4$  and  $V_5$  fig. 3  
 $V_2$  and  $V_5$  fig. 4  
 $V_1$  and  $V_2$  fig. 5 are linear.

Simple graphical means deliver the following relations.

$$V_4 = 5.4 V_5^{-1}$$

$$V_2 = 271 V_5^{-2}$$

$$V_1 = 0.13 V_2^{0.8}$$

Substitution in the equations leads to the following expressions.

$$\frac{F}{A\sigma_T} = 5.4 \left( \frac{\rho I^2 t}{F I^2} \right)^{-1}$$

$$\frac{\lambda \Pi^2}{I^2} = 271 \left( \frac{\rho I^2 t}{F I^2} \right)^{-2}$$

$$\frac{\lambda t}{c I^2} = 0.13 \left( \frac{\lambda \Pi^2}{\rho I^2} \right)^{0.8}$$

The variables occurring in the above relations are:

- |                           |   |                    |   |
|---------------------------|---|--------------------|---|
| 1. $\lambda = \lambda(T)$ | o | 7. $l$             | * |
| 2. $C = C(T)$             | o | 8. $A = \pi/4 d^2$ | * |
| 3. $\rho = \rho(T)$       | o | 9. $F$             |   |
| 4. $\sigma_T$             | o | 10. $t$            |   |
| 5. $T$                    | o | 11. $I$            |   |
| 6. $l$                    | * |                    |   |

As a practical example of the use of experimental data the following may serve.

The starting point is wire of a certain diameter. What values must the current, the warming-up time, the tensile force and the distance between the chucks have to obtain the desired shape of the pointed ends? If we proceed from wire with a given diameter, as in our case, the magnitudes marked with \* are given. If we, moreover, assume that the temperature as measured is the only one at which the process can properly take place, the temperature i.e. the magnitudes marked with o are also determined.

However, we still have three equations and three unknown variables, so we can calculate  $F$ ,  $t$  and  $I$  as a function of the diameter.

We find:  $l = l(d)$  from fig. 6  
 $F = F(d)$  " fig. 7  
 $t = t(d)$  " fig. 8

The results of the above data with  $\frac{1}{l} \approx 0,5$  are given below.

Table 4.  $F$ ,  $t$  and  $I$  as a function of the diameter

	$I$ in Amp.	$t$ in sec.	$F$ in N	$d$ in mm
Ni	$428 d$	$7.41 \cdot 10^{-2} d$	$98 d^2$	
NiFe	$245 d$	$7.93 \cdot 10^{-2} d$	$77 d^2$	
Fe	$322 d$	$7.25 \cdot 10^{-2} d$	$23.3 d^2$	
Cu	$1110 d$	$3.52 \cdot 10^{-2} d$	$141 d^2$	
Mo	$747 d$	$3.91 \cdot 10^{-2} d$	$108 d^2$	

### Discussion of the results

From this limited amount of measuring points, it cannot be expected that more accurate proportions can be determined between the dimensionless numbers.

The graphical working out for that purpose has to be limited to the primary stage.

Moreover, the values for  $\sigma_1$  in the various text books vary rather considerably.

Nevertheless in practice these numbers give some improvement over the trial and error method applied up till now.

### Conclusion

The foregoing dimensional analysis has shown a way to determine the required current, warming-up time and tensile force of different materials. In order to decrease the inaccuracy in the data available up till now, more experimental work of the type described has to be performed to come to sufficient accurate results. In this further set of investigations it will be necessary not only to increase the number of materials, but also to vary the diameter.

It may turn out that with these materials a useful shape of the pointed ends can also be obtained at temperatures other than those at which the experiments were done.

However, this could not be verified from test results taken from the available production machine, which was not at all intended for fundamental experiments.

Further tests on machines built specifically for experiments, may be useful for this purpose.

References

1. H.L. Langhaar  
"Dimensional analysis and theory of models"  
John Wiley and sons, Inc. London 1960
2. H.E. Huntley  
"Dimensional analysis"  
MacDonald - London 1958
3. A. Goldsmith, F.H. Waterman, H.J. Hirschhorn  
"Handbook of thermophysical properties of  
solid materials", Vol. 1  
The Macmillan Company - New York 1961
4. "Zahlenwerte und Funktionen aus Physik, Chemie,  
Astronomie, Geophysik und Technik", IV Band, 2e Teil  
Springer Verlag - Berlin 1957

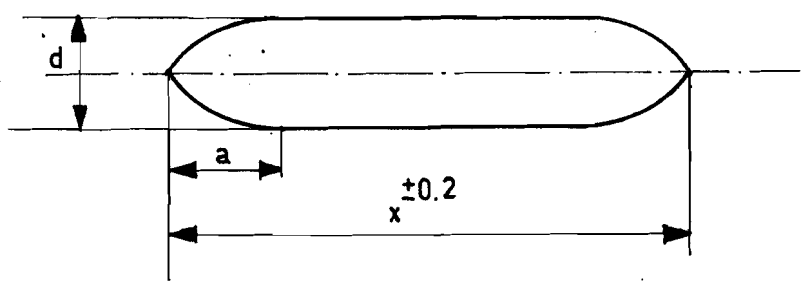


Fig.1 Product drawing.

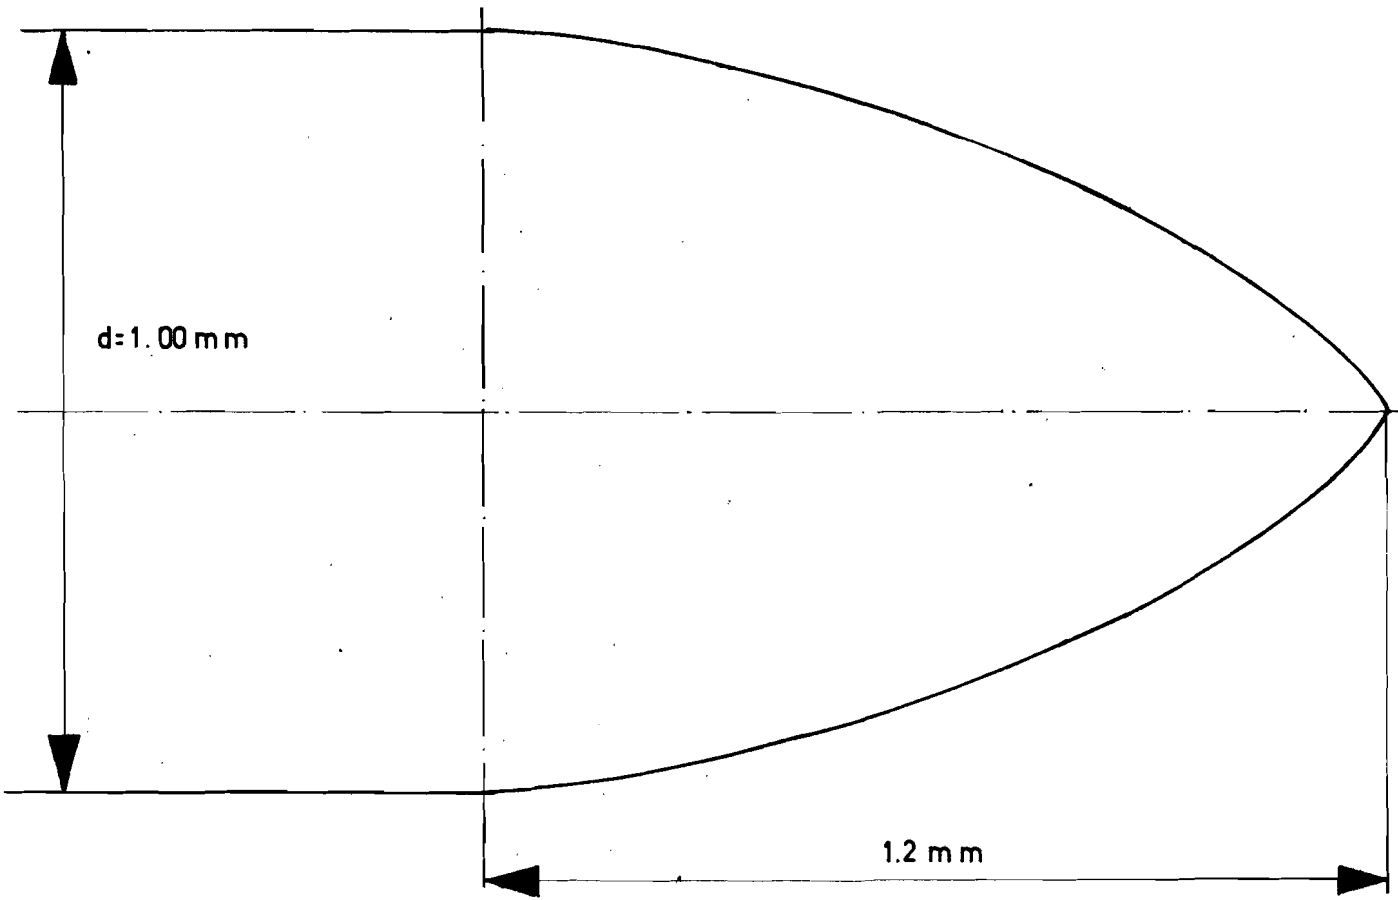


Fig.2 Empirically determined ideal shape of the pointed ends.

Fig 3. The relation between the dimensionless numbers  $V_4$  and  $V_5$ .

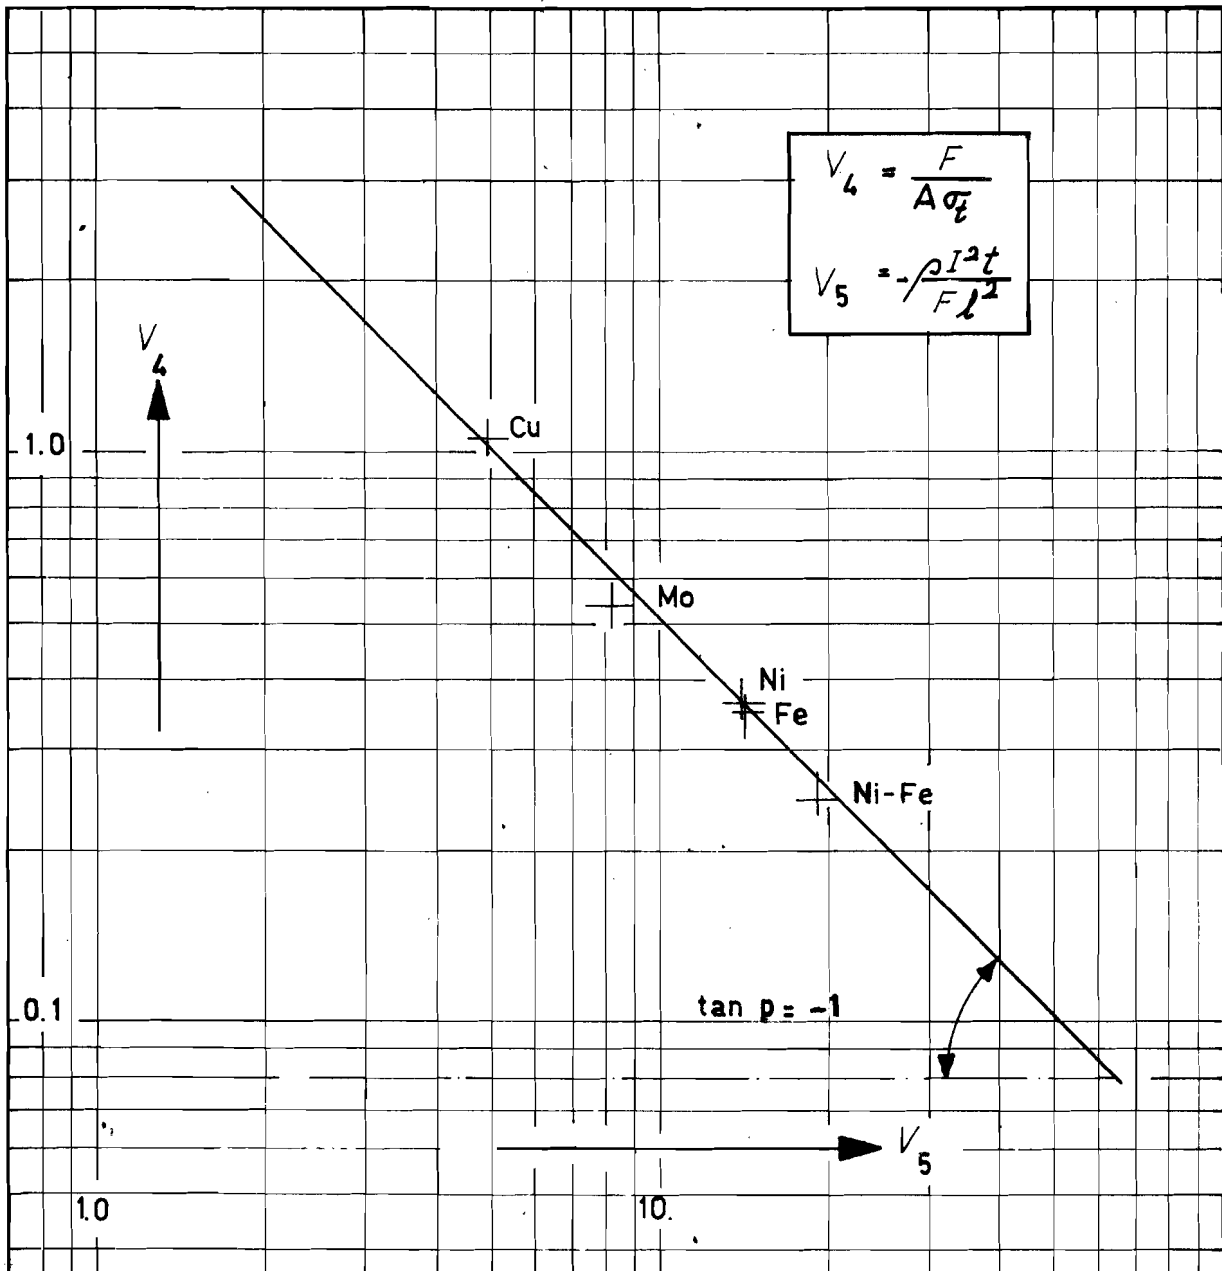




Fig 4. The relation between the dimensionless numbers  $V_2$  and  $V_5$ .

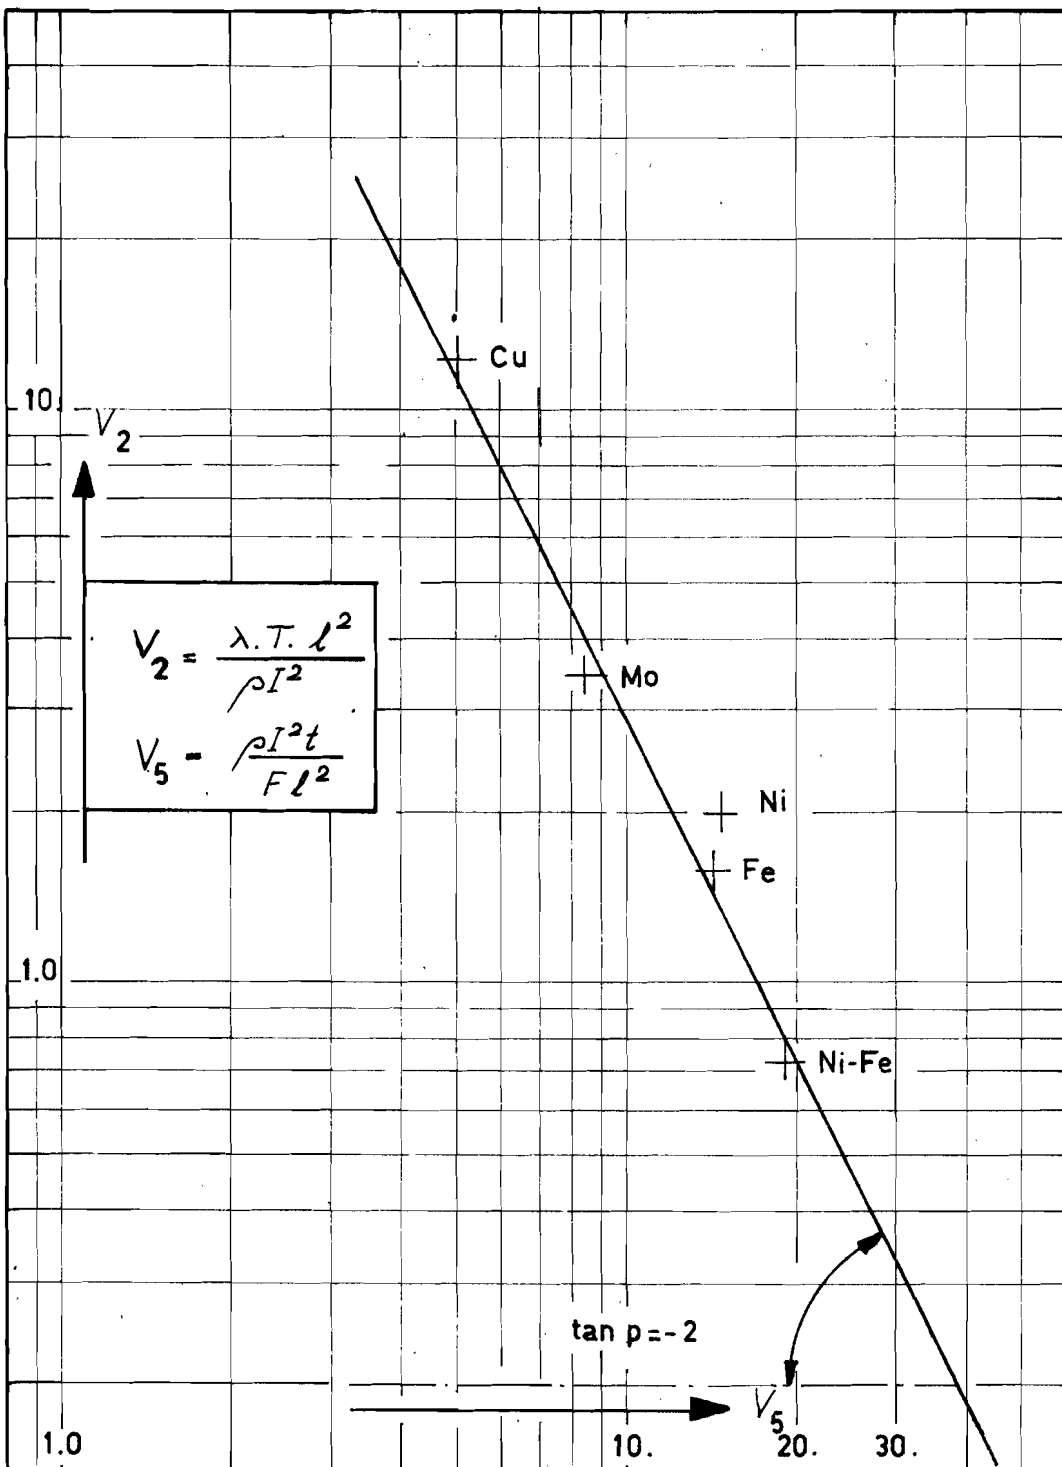


Fig. 5 The relation between the dimensionless numbers  $V_1$  and  $V_2$ .

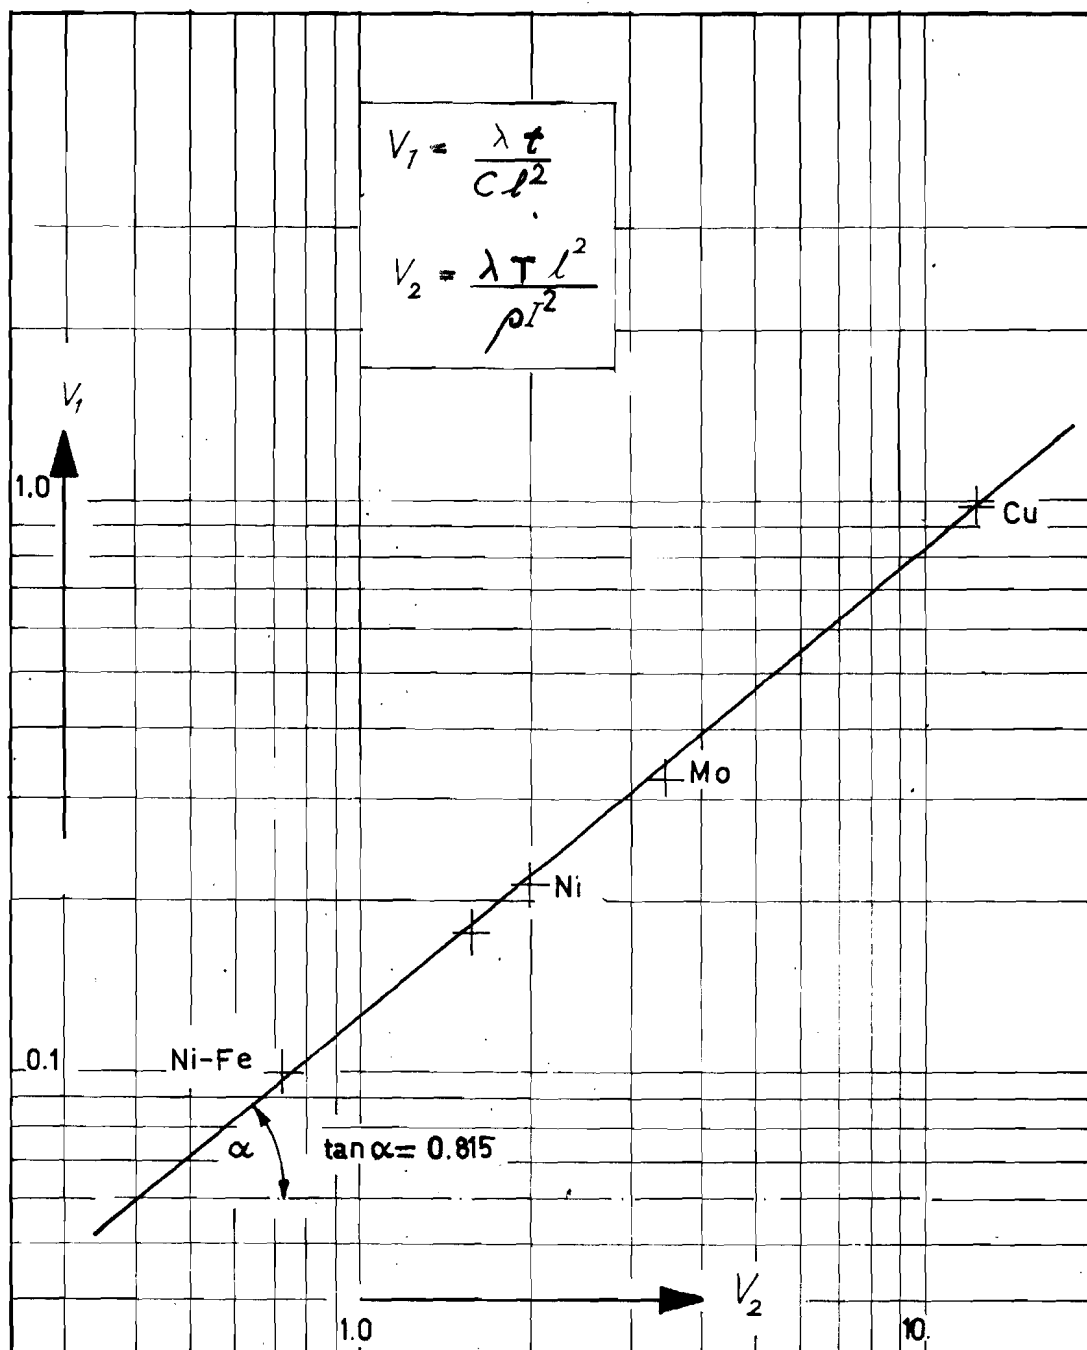


Fig. 6. The relation between the current  $I$  and the diameter  $d$ .

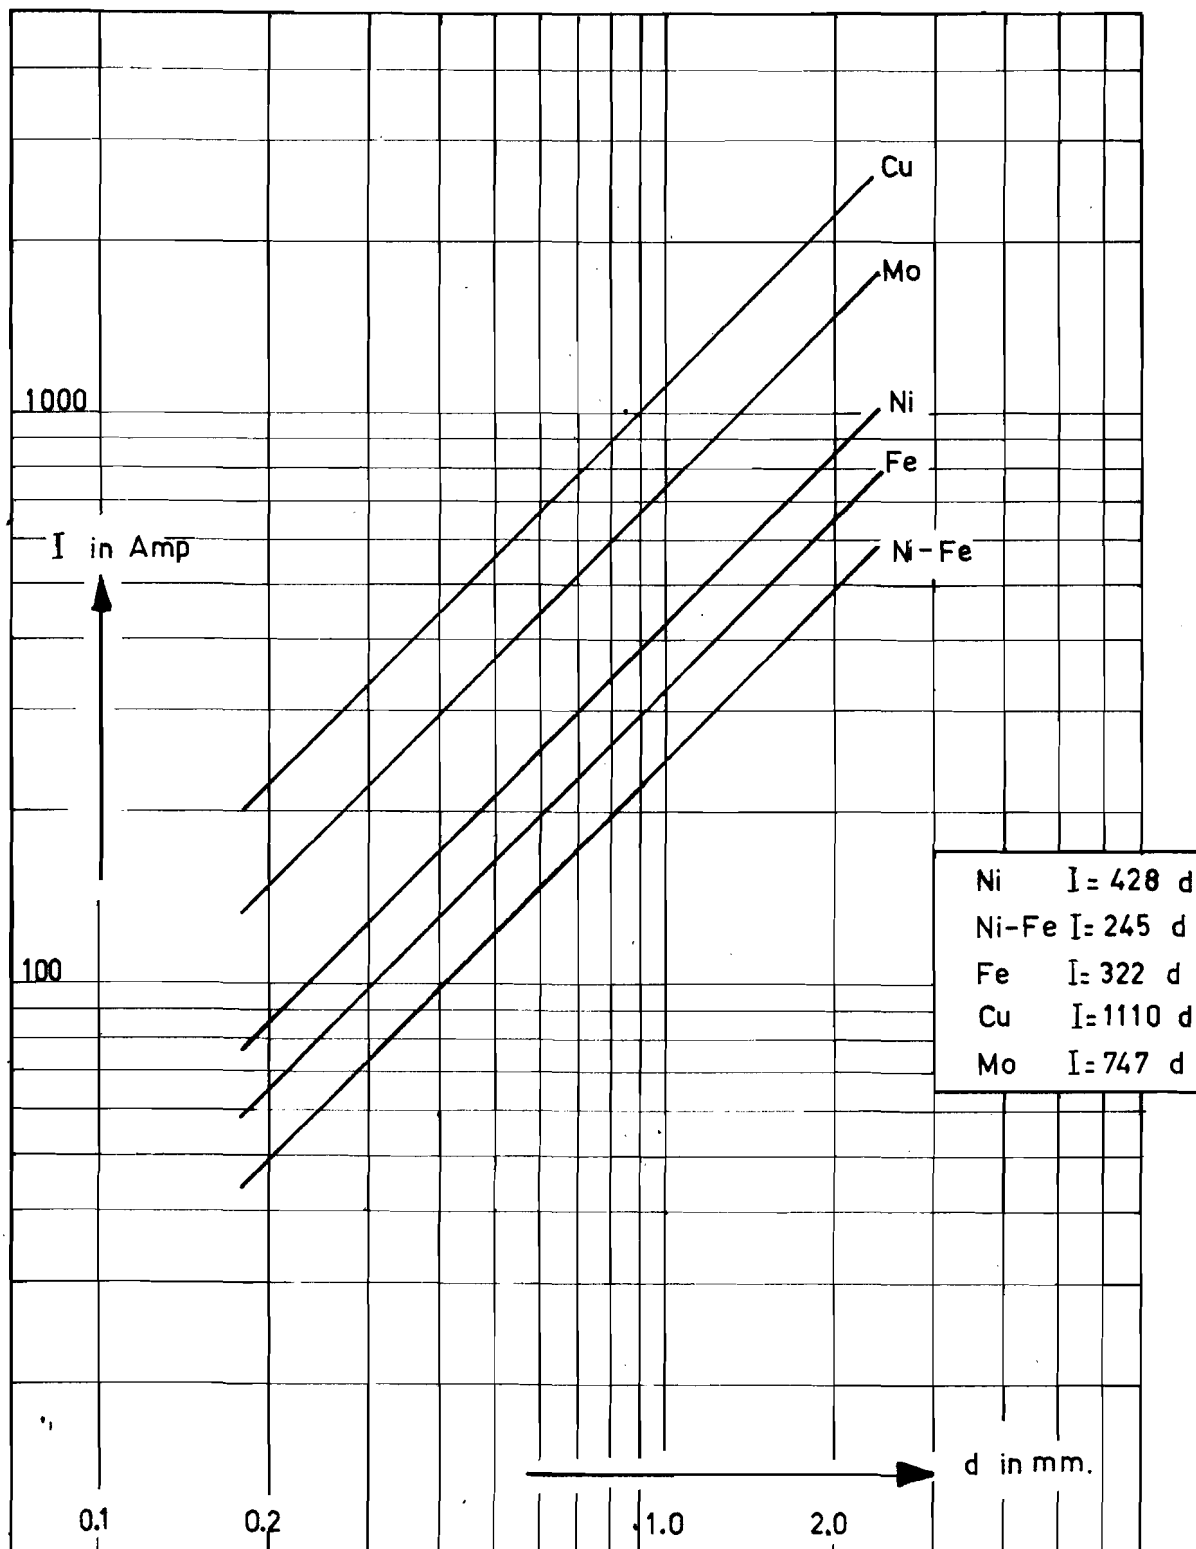


Fig 7 The relation between the tensile force  $F$  and the diameter  $d$ .

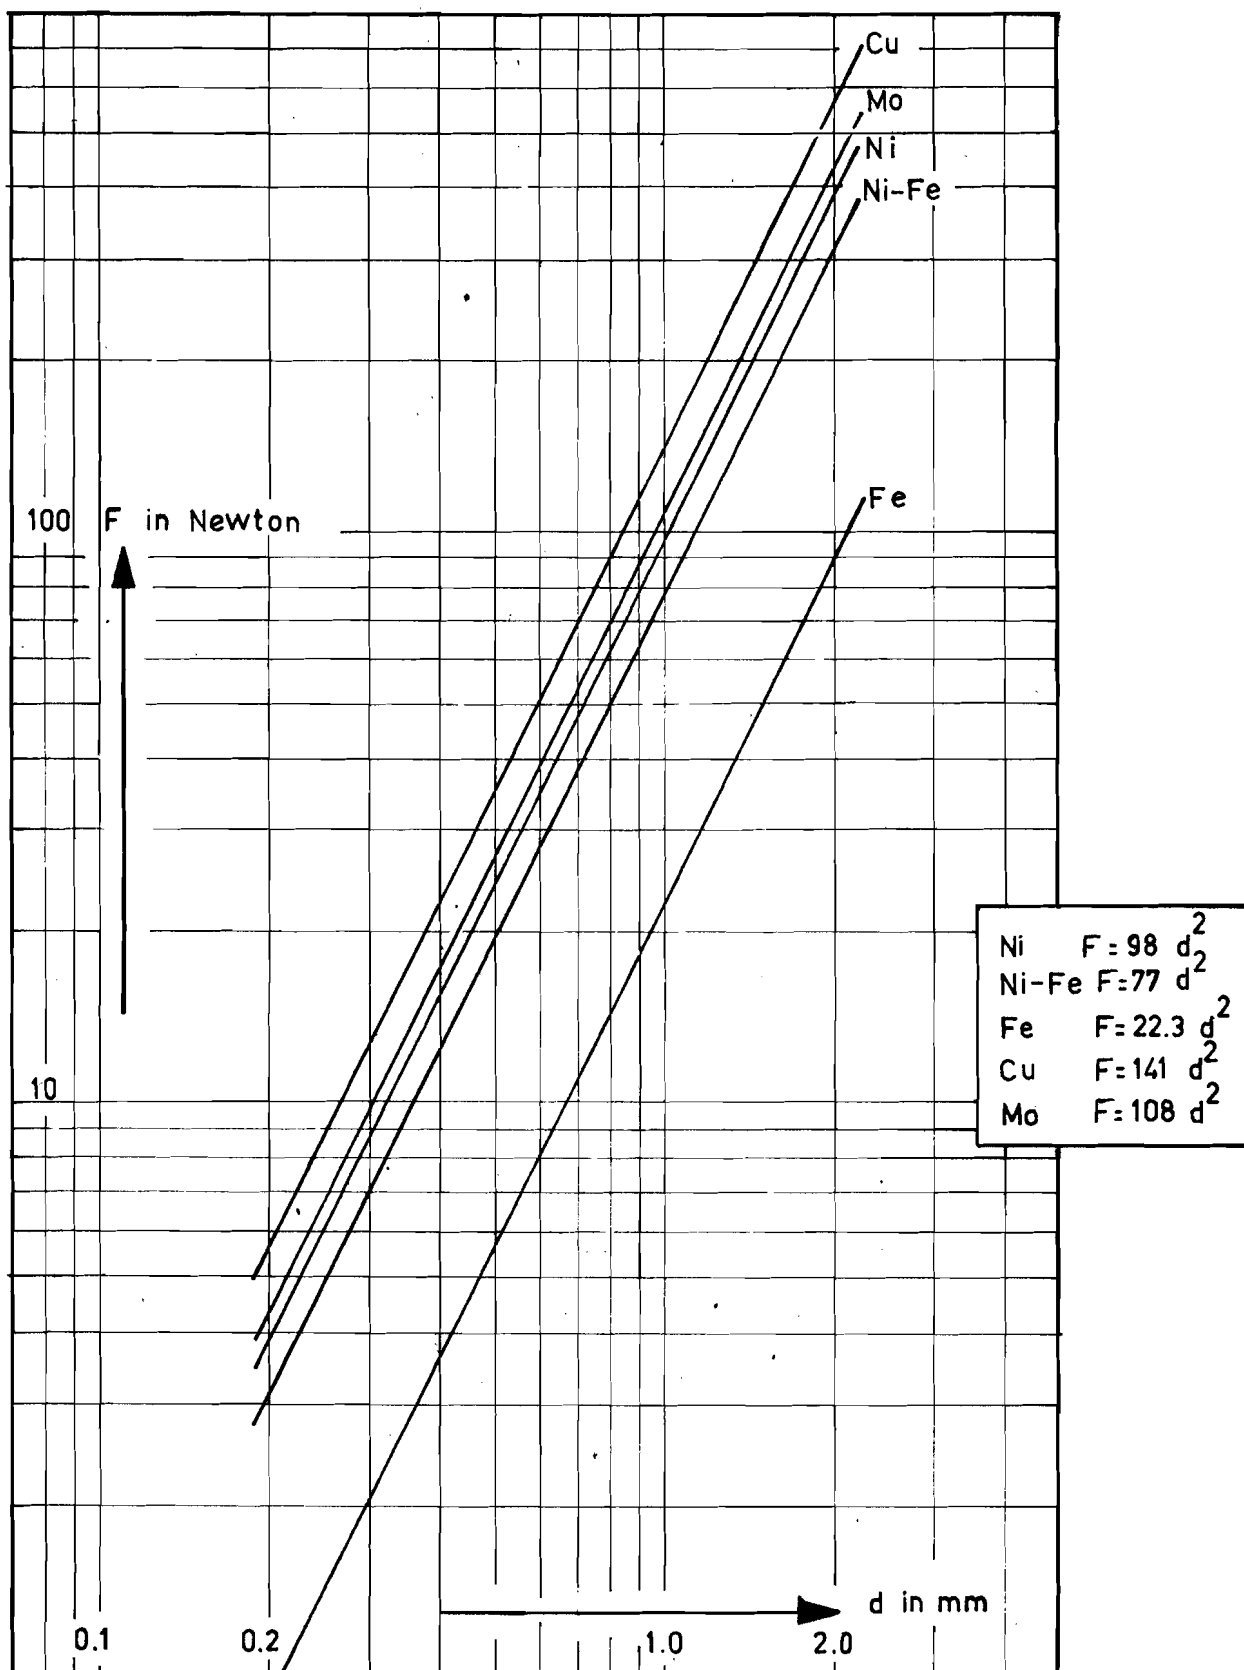


Fig. 8. The relation between the warming-up time  $t$  and the diameter  $d$ .

